



HOT MIX ASPHALT (HMA) PLANT INSPECTION

GENERAL

The Contractor's Certified, Level I HMA, Technician should witness the contractor operations, from the initial plant set up to the final shutdown. The contractor plant and method of operations should be examined thoroughly before work begins. Any deficiencies, which are observed with regard to specification compliance or safety, should be reported to the contractor and the engineer.

Normally, two certified technicians are required to perform the various materials quality control tests and plant production control inspection functions. The overall responsibility for plant inspection remains with the Contractor. This section deals primarily with this overall responsibility, therefore, no guidelines will be presented regarding division of duties and functions. The assignment of duties and functions of the inspection monitors are the responsibility of the Resident Construction Engineer and the District Materials Engineer.

PLANT INSPECTOR DUTIES

A. Preliminary

The first phase of the contractor operations consists of preparing the plant site and building stockpiles. The Contractor's certified technician should be assigned to the project prior to this phase of the work so that those procedures, which are governed by the specifications, may be observed and properly controlled.

The general areas or procedures requiring attention are:

1. Construction of Stockpiles to:
 - a. Minimize segregation
 - b. Eliminate contamination and intermingling

This is accomplished by constructing the stockpile in lifts, controlling stockpile height, controlling drifting and rolling of material, constructing partitions or bulkheads, and stabilizing the stockpile work area. Refer to the specifications for specific requirements.

<p>NOTE: All aggregate must be properly certified before being placed in the stockpile.</p>
--

2. Plant Erection Which Provides:

- a. Safe working conditions
- b. Reliable operation

This is accomplished by proper site preparation, placement of adequate foundations for bins and mixing equipment and constructing safeguards such as berms and drainage ways.

B. Job Mix Formula (JMF)

The job mix formula together with the specifications provide the initial basis for setting up and starting the job, therefore, the plant inspector must be thoroughly familiar with the information provided by the Job Mix Formula Report (Form #956).

Before the laboratory can develop a job mix formula, the contractor, material producers, and District Materials Engineer must make numerous arrangements in the field. The contractor must first select his/her material sources and estimate, in cooperation with the producers, the tentative proportions and gradations of each of the materials. The District Materials Engineer must be consulted before samples of the materials are obtained. The Contractor is responsible for the mix design per IM 510. Adjustments may be necessary in these proposed proportions since the exact gradations may not be known in advance.

If the composite gradation complies with the limits specified for the job mix formula, production limits are set for the individual aggregates by agreement between the Contractor and the Producer and documented on Form #955.

Aggregate production and inspection are covered in detail by [IM 204](#) and [IM 209](#).

If the materials as first analyzed do not consistently meet the specified limits, it may be necessary to adjust the proportion percentages or production limits. Familiarity with the material sources and production methods facilitates setting realistic limits. This reduces the number of trial and error steps and subsequent adjustments. It is advantageous to maintain records of this type for each material source and type.

When changes are made during the design stage, they will be incorporated in the job mix formula report. If changes are found necessary after production begins, they are to be made as provided for in [Materials IM 511](#) unless a complete new job mix formula is required.

A typical Mix Design Report with a description of information is shown on the following pages.

Form 956 ver. 6.0r

Iowa Department of Transportation

Highway Division - Office of Materials
HMA Gyratory Mix Design

County : Monona Project : IM-29-5(89)106--13-67 Mix No. : ABD4-001
 Mix Size (in.) : 3/4 Type A Contractor : Quality Construction Contract No. : 12345
 Mix Type: HMA 30M L - 2 Design Life ESAL's : 15,000,000 Date Reported : 03/12/04
 Intended Use : Surface Project Location : Southbound from MP 105.61 to 112.71

A

Aggregate	% in Mix	Source ID	Source Location	Beds	Gsb	% Abs	FAA
3/4 Cr. Lmst.	25.0%	A19512	Quality Aggregate	10-12	2.643	1.75	47.3
3/4 Clean Lmst.	15.0%	A19513	Quality Aggregate	14-21	2.624	1.21	45.0
3/8 Qtz. Chip	20.0%	A19515	Quality Aggregate	2-3	2.628	0.34	48.0
Man. Sand	25.0%	A19517	Quality Aggregate	5-12	2.662	2.09	49.3
Natural Sand	15.0%	A19518	Quality Aggregate		2.636	0.60	41.2

B

Job Mix Formula - Combined Gradation (Sieve Size in.)

1"	3/4"	1/2"	3/8"	#4	#8	#16	#30	#50	#100	#200
Upper Tolerance										
100	100	93	87	65	42		21			6.1
100	100	86	80	58	37	26	17	9.0	5.4	4.1
100	93	79	73	51	32		13			2.1
Lower Tolerance										

C

Asphalt Binder Source and Grade:		Quality Binder					PG 64-28
Gyratory Data							
% Asphalt Binder	3.85	4.35	4.85	4.87	5.35		<u>Number of Gyration</u>
Corrected Gmb @ N-Des.	2.347	2.370	2.389	2.390	2.415		N-Initial
Max. Sp.Gr. (Gmm)	2.532	2.509	2.490	2.490	2.476		8
% Gmm @ N- Initial	84.8	86.3	87.4	87.5	88.5		N-Design
% Gmm @ N-Max	93.7	95.5	97.1	97.2	98.8		109
% Air Voids	7.3	5.5	4.1	4.0	2.5		N-Max
% VMA	14.6	14.2	13.9	13.9	13.5		174
% VFA	49.8	60.9	70.9	71.2	81.7		<u>Gsb for Angularity</u>
Film Thickness	7.27	8.56	9.70	9.74	10.69		<u>Method A</u>
Filler Bit. Ratio	1.26	1.07	0.95	0.94	0.86		2.647
Gsb	2.641	2.641	2.641	2.641	2.641		<u>Pba / % Abs Ratio</u>
Gse	2.687	2.682	2.682	2.685	2.687		0.49
Pbe	3.20	3.78	4.28	4.29	4.71		<u>Slope of Compaction</u>
Pba	0.67	0.60	0.60	0.64	0.67		<u>Curve</u>
% New Asphalt Binder	100.0	100.0	100.0	100.0	100.0		13.8
Asphalt Binder Sp.Gr. @ 25c	1.036	1.036	1.036	1.036	1.036		<u>Mix Gmm Check</u>
% Water Abs	1.30	1.30	1.30	1.30	1.30		Excellent
S.A. m ² / Kg.	4.41	4.41	4.41	4.41	4.41		<u>Pb Range Check</u>
% + 4 Type 4 Agg. Or Better	100.0	100.0	100.0	100.0	100.0		1.50
% + 4 Type 2 or 3 Agg.	25.4	25.4	25.4	25.4	25.4		<u>Specification Check</u>
Angularity-method A	45	45	45	45	45		Comply
% Flat & Elongated	0.0	0.0	0.0	0.0	0.0		<u>TSR Check</u>
Sand Equivalent	82	82	82	82	82		82.0

D

Disposition : An asphalt content of 4.9% is recommended to start this project.

Data shown in 4.87% column is interpolated from test data.

Comments : _____

Copies to : Quality Construction Cent. Lab RCE Dist 3

Mix Designer & Cert.# : Jon Rayson 12345 Signed : _____

HMA MIX DESIGN

Refer to:

- A JMF aggregate proportions, sources
- B JMF target and design gradation with tolerances.
- C Source and grade of the asphalt binder used in the job mix formula.
- D The target asphalt binder content recommended to start mixture production. Expressed as a percent of asphalt binder, based on the total mass of the mixture. Established during the mixture design process.

C. Sampling and Testing

There are a number of sampling and testing procedures that a plant inspector must be familiar with and perform in order to establish and maintain acceptable quality construction. A number of these tests, measurements, and calculations, in addition to documenting specification compliance, also provide the basis for determining contract pay quantities.

Sampling frequencies are provided for in [IM 204](#) and the Standard Specifications.

Sampling and testing methods are provided for in IM 300 series. [IM 511](#) and the Standard Specifications provide directions on sampling and testing requirements.


D. Plant Equipment

Items of equipment to be checked for specification compliance prior to beginning operations are listed below:


1. Truck Scales or weigh hoppers
2. Cold Aggregate Feeders
3. Dryer
4. Dust Collector and Feeder
5. Cold-Feed Storage Bins and Feeders
6. Revolution Counters, and/or Scales
7. Thermometer Equipment.
8. Equipment for Heating, Storing and Measuring Asphalt Binder
9. Asphalt Pump, Surge Tank, and/or Scales
10. Testing Laboratory
11. Safety Requirements

Refer to the following plant diagrams and descriptions.

DRIER DRUM MIXER

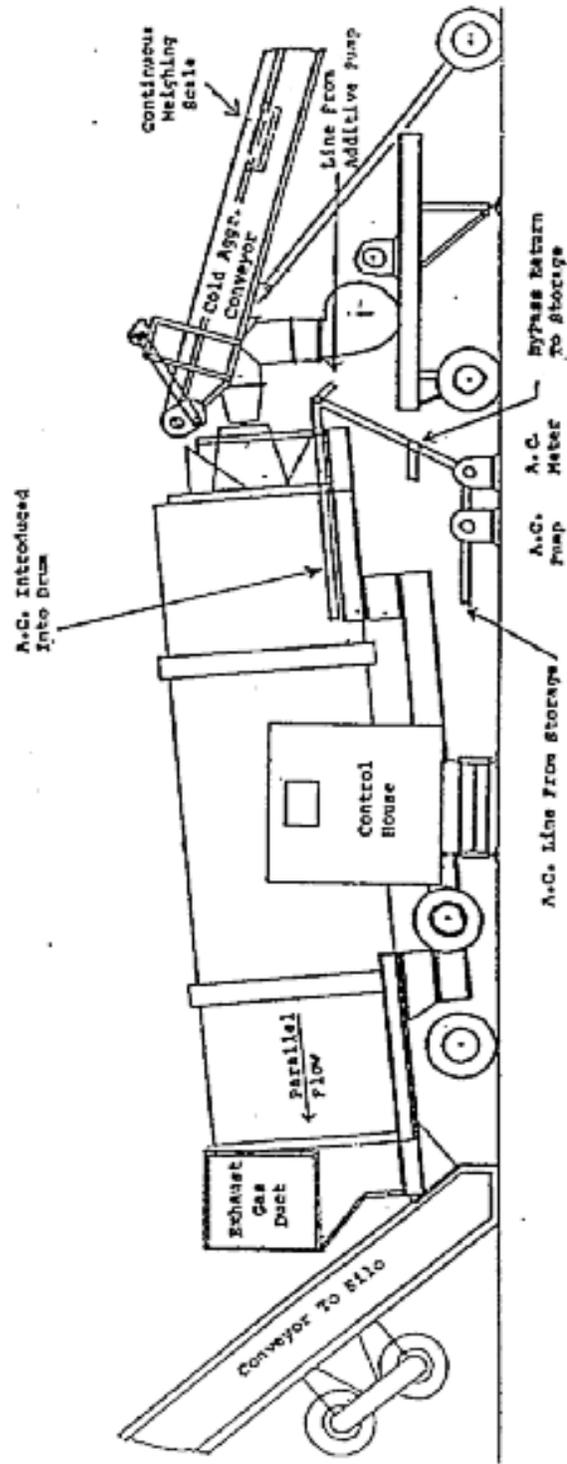

BATCH PLANT

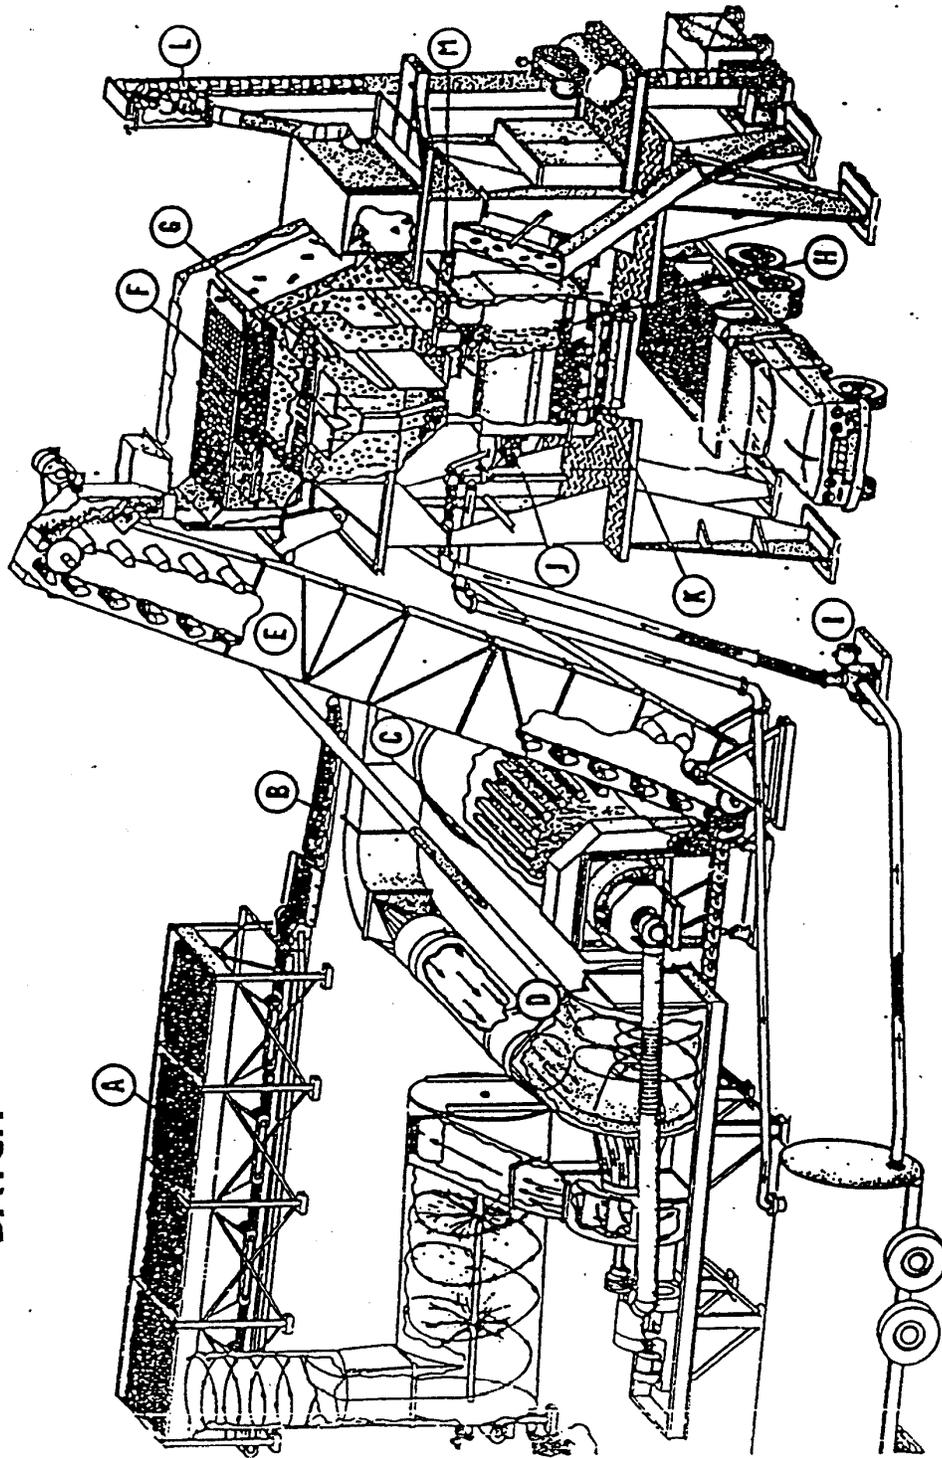

BATCH PLANT MATERIAL FLOW DIAGRAM

- A. Multiple Compartment Cold-feeder
- B. Cold Elevator
- C. Drier
- D. Horizontal Cyclone Dust Collector & Exhaust Washer
- E. Return Hot Aggregate Elevator & Dust
- F. Screening Unit
- G. Hot Aggregate Storage Bins
- H. Aggregate Batcher & Scale
- I. Asphalt Transfer Pump
- J. Asphalt Batcher & Scale
- K. Pugmill Mixer
- L. Optional Mineral Filler Elevator
- M. Optional Mineral Filler Feeder

E. Plant Calibration

The specifications require that all material proportioning equipment be calibrated and checked for accuracy. The job mix formula provides the basis for the calibrations.

The specifications require the contractor to provide personnel, scales, test weights, and equipment for calibrating each delivery component. The plant inspector shall determine moisture contents of the various materials. Use the formula:

$$\% \text{ moisture} = \frac{\text{wet mass} - \text{dry mass}}{\text{dry mass}}$$

The plant calibration may be monitored by and is subject to the approval of the District Materials Engineer or authorized representative. The plant inspector should be present and observe all procedures. The Contractor will furnish the plant inspector with copies of the calibration results, so adequate information is available for making adjustments when indicated. Should difficulty be experienced during plant calibrations, the District Materials Engineer should be contacted for assistance. Normally, the District Materials Engineer will assign one or more experienced inspectors to monitor the calibration of proportioning and mixing plants. The plant inspector should be thoroughly acquainted with plant operations, so problems are recognized and corrected as early as possible.

A sample calibration has been included as a guide in this section. Due to the wide variation in plant equipment, this example will not cover all situations, but it should provide the basis for understanding the overall procedure.

1. Cold Aggregate Feeders

The first step in calibrating a proportioning plant is the calibration of the cold aggregate feeders. These units determine the final gradation of the mixture.

a. Fixed Speed-Variable Gate Opening Cold-feeders

These feeders are controlled by gates, which meter the flow volumetrically. They are calibrated by weighing the quantity of material, which passes through a given gate opening during a measured time interval. The interval is determined by counting the number of revolutions that the feeder makes while the material is delivered. From the RPM of the feeder and the weight (mass) of the material, the deliver rate in pounds (kg) per minute is calculated (corrected for moisture). The calibration is graphed by plotting the pounds (kg) of dry aggregate delivered per minute at the gate openings used in the calibration.

b. Fixed Gate Opening-Variable Speed Cold-feeders

With this system, a gate opening is selected for each cold-feeder. This gate opening must be maintained throughout the calibration and the job. They are calibrated by weighing the amount of material delivered at several different speeds of the cold-feeder motor over a measured time interval.

The calibration is graphed by plotting the pounds (kg) of dry aggregate delivered per minute at the speeds of the cold-feeder motor used in the calibration.

These cold-feeders are equipped with a master control, which may be used to adjust the production rate. Changing the master control setting changes the speed of all the cold-feeders proportionately.

- c. With either type of cold-feed, the gate setting is very important and should be checked regularly.
- d. Refer to the example calibration forms included.

2. Conveyor Scales

The specifications require Drier Drum Mixing Plants be equipped with continuous weighing central conveyor scales that are interlocked with the asphalt deliver system. These scales are checked for accuracy by two methods as follows:

- a. The scale is first zeroed while the conveyor is operating at normal operating speed, but unloaded. It is then adjusted to readout a predetermined total weight (mass) using the special scale beam weights and a standard operating time interval. Both of the foregoing procedures are to be performed in accordance with the scale manufacturer's instructions.

-
- b. The second accuracy check requires the comparison of the weight (mass) shown on the totalizing meter, with the weight (mass) actually delivered as determined by running material over the conveyor into a tared truck. The truck tare and loaded weights must be obtained by weighings over certified commercial truck scales, or plant scales that have been checked against certified scales and approved by the Engineer. The conveyor scales should be checked at several delivery rates representing the proposed operating range. The contractor shall adjust the weighing system so that when the plant is operating, the final mixture is uniform and consistently within the specified job mix formula tolerances.

3. Asphalt Pump

Some batch plants, all continuous and drum mixing plants deliver asphalt material to the mixer through volumetric pumps. The pumps are adjusted by changing drive sprockets or movement of a vernier dial control. These volumetric systems must be calibrated throughout the proposed operating range at the normal operating temperature. When totalizing meters are required, they must be adjusted to readout the quantity delivered within the specified deliver tolerance.

If the contractor elects to use in-line flow meter readings for pay, the meter must be accurate to plus or minus 0.2% as demonstrated through the calibrations process or by comparison to tank stick readings if approved by the DME. If this degree of accuracy cannot be attained, measurement for pay shall still be by tank stick. Unless otherwise approved by the DME, use a certified truck scale in the calibration of flow meters.

When a flow meter is used for pay, yield checks will be performed.

4. Hot Aggregate Feeders on Batch Plants

After the various aggregates have been proportioned and dried, they are fed to the mixer unit.

- a. On batch plants the hot aggregates are weighed in batches over calibrated scales as described in the following paragraphs and examples.

The dust collected by the dust collector is fed from a calibrated bin or returned directly to the hot aggregate, depending on the type of plant equipment and the specification requirements. If the dust is returned separately, the feeder should be calibrated to feed the required quantity of dust in a uniform manner. If the dust is returned directly to the hot aggregate the weight or volume of dust collected and returned is taken into account automatically in the calibration of the hot aggregate delivery system or batch weights.

When gradation control is by cold-feed samples, and the batch plant is equipped with hot aggregate screening units, they should be removed or covered so that the gradation is not altered by the balance of the hot bin delivery settings. If the Contractor would like to use the hot aggregate screening process, the approval of the DME is required before beginning. If this process is used, the gradation control will be based on samples obtained from the hot aggregate delivery or on the extracted gradation from samples of the hot mix. When hot aggregate screening is used, the delivery of each hot bin must be

calibrated similarly to the cold feed bins.

5. Batch Plant Scales

Calibration of batch plant scales as required by the specifications is performed by incrementally loading the scales with standard test weights and partial batches through the operating range of the scales. As each increment of load is applied, the actual observed weight and the required weight are compared. The differences, plus or minus, are determined and converted to percentages of the required weight. If the percentage deviations are less than the tolerance allowed by the specifications and the scales are sensitive to the test loads, the scales will be considered in calibration. If the scales do not meet the various requirements, the contractor is required to make the necessary repairs or adjustments. Recalibration may be ordered by the engineer if the scale equipment malfunctions or if required material quantities do not agree with actual material quantities. If the batch plant scales are to be used for the determination of pay quantity, a scale calibration to the proper accuracy is required.

6. Initial Plant Settings

Three examples of initial plant settings have been provided: one for a drum mix plant, one for a 3000-pound (1,361-kg) batch plant with a volumetric asphalt measurement, and one for a continuous plant with a sprocket type asphalt pump.


The plant inspector is at this point cautioned not to make adjustments or effect settings of plant equipment, and in no way manipulate or operate any equipment at any time. All operations connected with the contractor plant or other equipment are by specification the strict and total responsibility of the contractor.

7. Mixing Rate

The specifications contain requirements regarding the quality and duration of mixing for the various types of mixes and plants. The design, condition, speed and loading of the mixer unit together with the characteristics of the materials being mixed will vary from job to job and need to be taken into account when evaluations are made.

Mixing times are determined in the following manner:

- b. Batch Plants. The mixing rate of batch plants is controlled by the batch size and the dry and wet mixing timer settings. The batch size should not exceed the manufacturers rated capacity and the timer should be set to provide the specified mixing time unless more or less time is authorized by the engineer. The accuracy of the timer may be checked with a stopwatch if necessary.

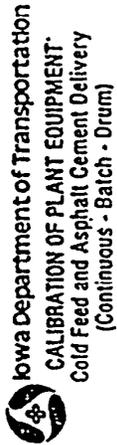

Form 872118
3-86

County Tama
 Project FA-30-6(44)-26-86
 Date 8-4-96
 Proj. Eng. John Peters
 Material Ident. & % 34 Cr. Lmst. 88% Moisture 2.6 %
 Material Ident. & % Sand 30% Moisture 4.0 %
 Material Ident. & % RAP 12% Moisture 5.1 %
 R.P.M. Feeder/Plant/Master: Maximum Plant Set for 300 TPH
 #1 SAND #2 and 3 #4 Cr. Lmst. #5 R.A.P.
 Contractor Ceasford Const. Plant Location Montour Quarry
 Plant Type and Name Sand Ponds - Dry Mix Pollution Control
 Mix Type B Binder Recycled Class I Mix Size 3/4" Gate _____
 Asphalt Type and Grade AC-10 Temperature of _____

Run number	1	2	3	1	2	3	1	2	3	1	2	3
Revolutions delivered/Time delivered												
Total wet weight aggregate delivered/TPH wet												
Total weight A.C. delivered												
Total dry weight aggregate delivered/TPH Dry												
Dry weight per revolution												
Dry weight per minute												
Average dry weight per (Minute flow)/Tach set point												

Gate 6" 88.0 Gate 6" 48.0 Gate 6" 29.0 Gate 4" 79.0
 Date scale was certified 8-4-86
 The above data is furnished as set forth in the Standard Specifications for plant operations, for informational purposes only. The Contracting Authority makes no representations as to accuracy, either expressed or implied, which are to be construed to relieve the Contractor from the responsibility to comply with the specifications.

Distribution:
 White Copy - Plant Inspector
 Canary Copy - Inspector
 Pink Copy - District Materials Engineer
 Goldanced Copy - District Engineer
 Calibrated by Theodore Huismar Monitored by Mark Trublood
 Contractor Ceasford Construction Title Asphalt Tech-Dist Materials

FORM 20015
3-84

**CALIBRATION OF PLANT EQUIPMENT
(DRUM MIX PLANT)**

County Tama
Project EA-30-6(44)-26-86
Date 8-4-88
P. o. J. Eng. Tom Reis

Contractor Cesford Construction Plant Location Montour Quarry
Plant Type and Name Cedar Rapids Drum Mix Pollution Control Baghouse
Mix Type A Surface Class 3/4" Mix Size
Asphalt Type and Grade AC-10 Temperature °F 8.55 A.C. #/Gal.

WEIGHT BELT		A.C. PUMP		WEIGHT SILO	
Run Number		Meter Er. Gals.	Run Number		
Span	2541 2578 2578	299	300		
Fine Zero	5524 5524 5524	Corrected Gals.			
Total weight aggregate lbs.	17,640 17,460 17,500	Metered lbs.	2556 2565	Total weight lbs.	28160 28500
Truck total weight aggregate lbs.	17,900 17,440 17,490	Truck lbs.	2560 2568	Truck lbs.	28180 28570
Difference	-260 +20 +10	Difference	-4 -3	Difference	-20 -10
% Error	1.45 0.10 0.06	% Error	0.16 0.12	% Error	0.07 0.04

Date scale was certified 8-4-88
Sensitivity check on weightsilo
was OK.

The above data is furnished as set forth in the Standard Specifications for plant operations, for informational purposes only. The Contracting Authority makes no representations as to accuracy, either expressed or implied, which are to be construed to relieve the Contractor from the responsibility to comply with the specifications.

Calibrated by Ted Huizman Witnessed by Mark Trueblood
Contractor Cesford Construction Title Asphalt Tech - District Materials

Distribution:
White Copy - Plant Inspector
Canary Copy - Contractor
Pink Copy - District Materials Engineer
Goldenrod Copy - Project Engineer

ASPHALTIC CONCRETE
 BATCH PLANT

PROJECT: 115T-9-B (16)--4A-96
TYPE: A Surface
CONTRACTOR: Fred Carlson

INTENDED A.C. =
 5.5 %

SIZE OF BATCH: _____ AGGREGATE: _____ ASPHALT: _____

Used 1200⁺ of Weights

ASPHALT SCALE						AGGREGATE SCALE					
APPLIED LOAD	SCALE READING					APPLIED LOAD	SCALE READING				
	RUN:	#1	#2	#3	#4		RUN:	#1	#2	#3	#4
						150		✓			Acc. Error
						300		✓			
						450		+3			
						600		+2			
						750		+1 1/2			
						900		✓			
						1050		✓			
						1200		-1 1/2	-1 1/2		
						1350		-1 1/2			
						1500		-7 1/2			
						1650		-7			
						1800		-7			
						1950		-7 1/2			
						2100		-6			
						2250		-6			
						2400		-3	-4 1/2		
						2550		-3			
						2700		+2			
						2850		+4			
						3000		✓	-4 1/2		

Note: Do to misrange scale error no batches below 2100 lbs will be allowed!!

SRe _____ #
 SR # @ _____ #

SRe OK 1 #
 SR 1 # @ 3000 # 0

181 *M. Colledge* DATE 6-7-88
 witnessed by *Matt Kent* etc

Iowa Department of Transportation
CALIBRATION OF PLANT EQUIPMENT
Cold Feed and Asphalt Cement Delivery
(Continuous - Batch - Drum)

County Winn
Project US-980A-96
6-7-88
Prof. Eng. Edman

Contractor Fred Carver Plant Location Decorah Pit Material Ident. & % Oil Moisture _____ %
Plant Type and Name H+B Pollution Control Bag House Material Ident. & % _____ Moisture _____ %
Mix Type A Class Surface Mix Size 1/2 Gate _____ Material Ident. & % _____ Moisture _____ %
Asphalt Type and Grade Koch AC-10 Temperature °F _____ RPM Feeder/RPM Plant/Master _____ Plant Set for _____ TPH


Run number	1	2	3	4	5	6	7	8	9	10
Pump vernier setting/gate opening in inches/Oral setting	<u>Oil 15</u>			<u>Oil 25</u>			<u>Oil 25</u>			<u>Oil 30</u>
Revolutions delivered/Time delivered	<u>Gross 148 5155</u>			<u>276 5235</u>			<u>276 234</u>			<u>255 27 266</u>
Total wet weight aggregate delivered/TPH wet	<u>TAW 42.550</u>			<u>50 53 52 55</u>			<u>54.5 53 52.5</u>			
Total weight A.C. delivered	<u>NT 176.0105</u>			<u>176.5 180.5 174 179</u>			<u>217 218.5 213.5</u>			
Dry weight per revolution =										
Dry weight per minute =										
Average dry weight per (Minute-Rev.)/Tach set point	<u>105.75</u>			<u>177.5</u>			<u>216.7</u>			

Date scale was certified July 27 87

The above data is furnished as set forth in the Standard Specifications for plant operations, for informational purposes only. The Contracting Authority makes no representations as to accuracy, either expressed or implied, which are to be construed to relieve the Contractor from the responsibility to comply with the specifications.

Distributions:
• White Copy - Plant Inspector
• Green Copy - Contractor
• Pink Copy - District Materials Engineer
• Blue/Red Copy - Project Engineer

Calibrated by K. J. [Signature] Witnessed by [Signature]
Contractor _____ Title A.C. Tech

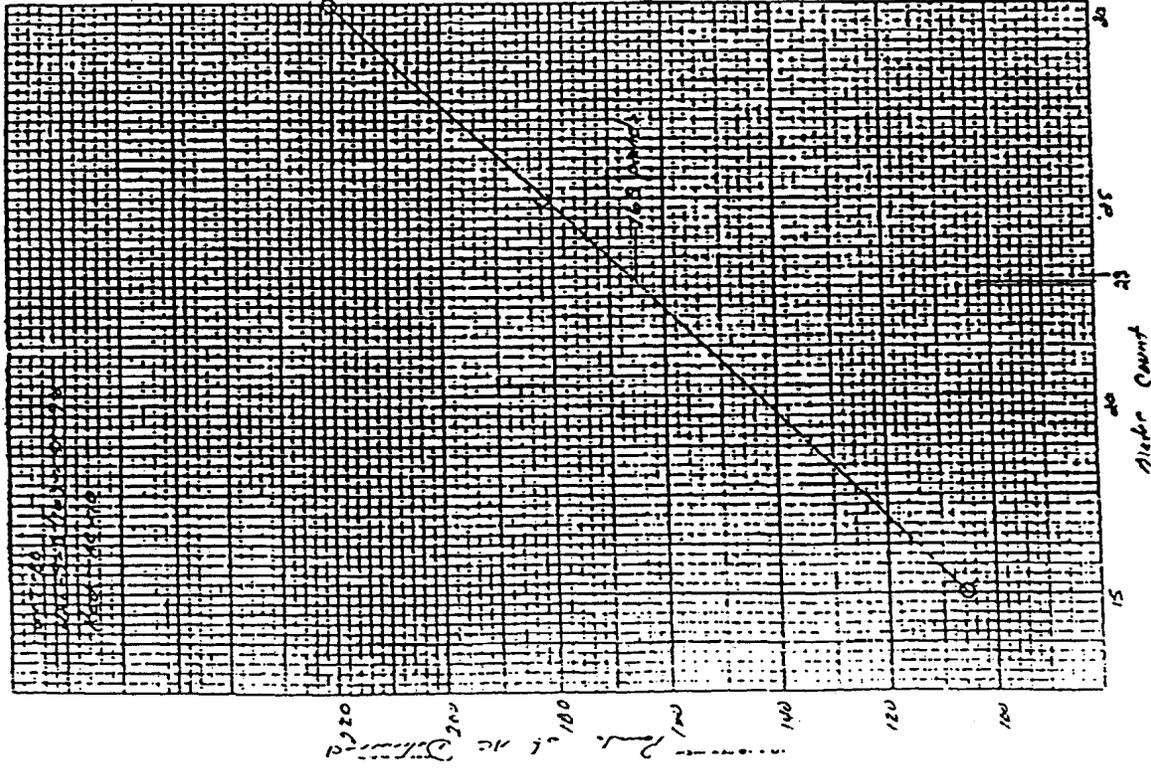

Form 1000

Iowa Department of Transportation
CALIBRATION OF PLANT EQUIPMENT
Cold Feed and Asphalt Cement Delivery
(Continuous - Batch - Drum)

County Winneshiek
Project IIST-9-R(116)-4A-96
Contract No. _____
Date 6-7-88
Proj. Eng. Erdman

Contractor Fred Carlson Co. Plant Location Decorah Pw Material ID Inst. 4% 60 Moisture 4.2 %

Plant Type and Name H.B. Pollution Control Bag House "waterfall" _____ Moisture _____

Mix Type A Class Surface Mix Sto. 1/2" Material ID _____ Moisture _____

Asphalt Type and Grade Koch AC-10 RPM Feeder/Plant/Master 20.1 Plant Set _____ For _____ mg/hr (TPH) Material ID _____ Moisture _____


Run Number	2	2	2			
Pump vernier setting/gate opening in mm(Ch) dial setting	3"	4"	5"			
Revolutions delivered/Time delivered	80.7 81.1	81.2 81.2	81.8 81.2			
Total wet mass(wt.) aggregate delivered mg/hr (TPH) wet	4760 4740	6450 6520	8670 8660			
Total weight of aggregate delivered						
Total dry mass(wt.) aggregate delivered Dry	4568 4549	6190 6257	8321 8311			
Dry mass (wt.) aggregate per revolution	56.6 56.1	76.2 77.1	102.3 102.4			
Dry mass (wt.) aggregate per minute	1138 1127	1532 1549	2057 2057			
Average dry mass (wt.) agg. per (Minute-Rev.)/Tach set point	1132.5	1540.5	2057			

Date scale was certified Sept 27, 87

The above data is furnished as set forth in the Standard Specifications for plant operations, for informational purposes only. The Contracting Authority makes no representations as to accuracy, either expressed or implied, which are to be construed to relieve the Contractor from the responsibility to comply with the specifications.

Calibrated by Mike Falkenberg Witnessed by Mark J. Lutz
Contractor _____ Title P.C. Tech

Duplicate: White Copy - Plant Inspector; Green Copy - Contractor; Pink Copy - Transportation Center Materials Engineer; Yellow Copy - Project Engineer

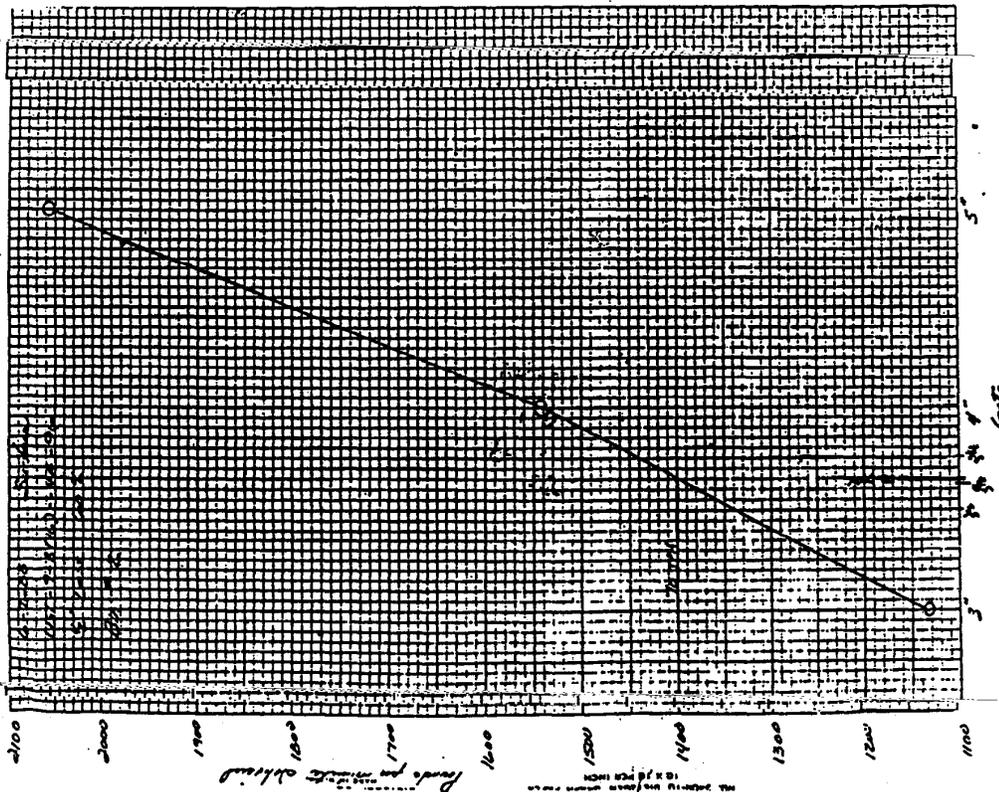

Form 508-100

Iowa Department of Transportation
CALIBRATION OF PLANT EQUIPMENT
Cold Feed and Asphalt Content Delivery
(Continuous - Batch - Drum)

Contract W-110
Project UST-9-2(16) 1-4A-96
Date 6-7-88
Proj. Eng. Edyucan

Contractor Fred Carlson Plant Location Decorah Pit Material Moist. & % Sand 40% Moisture 3.1 %
Plant Type and Name H+5 Pollution Control Dusthouse Material Moist. & % _____ Moisture _____ %
Mixer Type _____ Class A Mix Size _____ Cold _____ Material Moist. & % _____ Moisture _____ %
Asphalt Type and Grade Koch AC-10 5 1/2 Temperature °F _____ RPM Feeder/TPH Plant/Master 208 Plant Set for _____ TPH


No. Recept.	2"	3"	4"
Pump vibrator setting/gate opening in inches/Dial setting	2"	3"	4"
Run number	31	32	33
Revolutions delivered/Time delivered	631/63.1	630/63.3	634/63.3
Total wet weight aggregate delivered/TPH wet	2740/2750	4020/4020	5400/5380
Total weight A.C. delivered	2155/2115	3889/3889	5238/5218
Total dry weight aggregate delivered/TPH Dry	2155/2115	3889/3889	5238/5218
Dry weight per revolution	42.1/42.3	61.9/61.6	82.6/82.4
Dry weight per minute	276.8/271	1287/1281	1718/1715
Average dry weight per (minute-Rev./) each set point	277.5	1284	1716.5

Date scale was certified 5-1-77 AT

The above data is furnished as set forth in the Standard Specifications for plant operations, for information purposes only. The Contracting Authority makes no representations as to accuracy, either express or implied, which are to be construed to relieve the Contractor from the responsibility of complying with the specifications.

Dist./Recep:
White Copy - Plant Inspector
Green Copy - Contractor
Pink Copy - District Materials Engineer
Gold/Red Copy - Project Engineer

Calibrated by Kirk Lull Witnessed by Mel Pitt
Contractor _____ Title A.C. 7/22

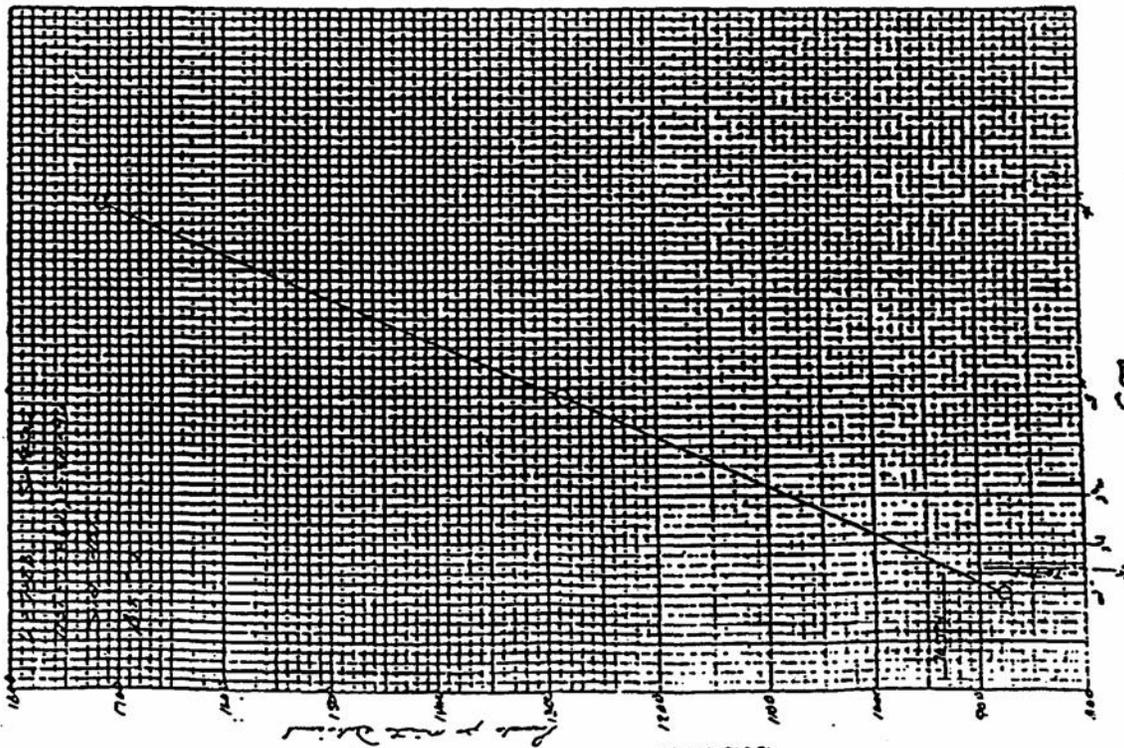

INITIAL PLANT SETTING

TYPICAL PLANT COLD-FEED SETTINGS

The following example is based on initial plant output of 70 TPH (63,500 kg/hr) of mix. See example.

Set for 70 TPH (63,500 kg/hr.) total cold-feed aggregate (Dry Weight):

$$\frac{70 \text{ TPH} \times 2000 \text{ lbs./ton}}{60 \text{ min./hr.}} = 2333 \text{ lbs./min. of mix}$$

$$\frac{63,500 \text{ kg/hr.}}{60 \text{ min./hr.}} = 1,058 \text{ kg/min. of mix}$$

<u>Material</u>	<u>% in Mix</u>	<u>kg/min. (lbs./min.)</u>	<u>Gate Setting</u>
1/2 in. (12.5 mm) Cr. Stone	60%	35 1400	Approx. 3 5/8
Sand	40%	423 933	Approx. 2 1/8

DRUM MIXING PLANT

The following example is based on initial plant output of 300 TPH (272,160 kg/hr.). See example.

Set aggregate delivery controls on plant control console to deliver 300 TPH (272,160 kg/hr.) of dry aggregate.

Master control set on maximum.

<u>kg/hr or TPH</u>		<u>kg/hr or TPH</u>
272,160 or (300) x 58% 3/4 inch crushed limestone	=	157,853 174
272,160 or (300) x 30% Sand	=	81,648 90
272,160 or (300) x 12% RAP	=	<u>32,659</u> <u>36</u>
100%		272,160 300

BATCH PLANT SETTINGS

After the aggregate scale and asphalt scale has been checked for accuracy, the batch weights are set and mixing operations are begun. The scales are checked by adding weights to the hopper and observing the scale dial indicators (see examples). Some batch plants are equipped with volumetric asphalt pumps rather than scale buckets; these devices are calibrated the same way that asphalt pumps are calibrated on drum-mix plants, but operated on a batch basis:

Assume 3000 lb. (1,361 kg) batch plant, cold-feeds as cited previously and 5.5% binder content.

SCALE SETTING

Binder: 5.5% x 3000 lbs. (1,361 kg) = 165 lbs. (75 kg) per batch (see example)

Combined Hot Aggr: 3000 lbs. (1,361 kg) – 165 lbs. (75 kg) = 2835 lbs. (1,287 kg) per batch

Asphalt pump (volumetric) = 165 lbs. (75 kg) per batch = 23 counts per batch (see example)

If the dust is returned directly to the hot aggregate, separate computations are not required for the dust being fed since it is automatically included in the hot aggregate delivery.

All gate and scale settings and weighing controls shall be set to target on the required quantities. Offsetting shall not be permitted, except to correct calibration errors.

F. Production Inspection Duties

1. Temperature Control

It is necessary to observe and control the temperature of the various material components to document specification compliance, to prevent damage to the material, and to produce uniform workable mixtures. The specifications contain the ranges and tolerances for each type and class of mixture. The specification limits for mix temperature are the same for all plant types. Production above or below these limits must be approved in advance by the Engineer, and documented as set out in [Section 1108.04 of the Standard Specifications](#).

Point of Test (Temperature)

- | | |
|--|--|
| • Asphalt Binder | Delivery units and storage tanks |
| • Aggregate | Dryer Pyrometer |
| • Final Mixture | Point of Discharge from mixer (May be obtained from the internal instrumentation providing real-time information to the control house) |
| • Final Mixture (on road) Behind Paver | |

2. Gradation Control

a. Cold-feed Gradation Control

The contractor is responsible for ensuring the gradation of the final mixture consistently complies with the requirements of the job mix formula. Cold-feed proportioning will be monitored and verified as part of the overall plant inspection activity. The final acceptance gradation will normally be based on the cold-feed gradation.

Advisory sampling and testing will be performed at the aggregate sources and after cold-feed combination at the plant site. Cold-feed check samples will be taken daily to verify the accuracy of proportioning and to provide guidance to the contractor with regard to mixture gradation. Additional quality tests above the minimum specified may be run at the option of the District Materials Engineer.

The sampling and testing frequencies are outlined in [Materials. IM204](#). Samples must be secured in a safe and reliable manner as provided in [Sections 1108](#) and [2001](#) of the Standard Specifications. Testing procedures shall be in accordance with IM Series 300.

The cold-feed samples are to be obtained by incrementally cutting the stream or belt flow of combined aggregate feeding the drier. The contractor is responsible for furnishing a plant set-up that allows representative samples to be obtained. This may require equipment modification.

b. Non-compliant cold-feed gradation and other production mix irregularities may result from the following causes:

- Sample not representative of lot (Multiple hot bins)
- Improper bin balance
- Test errors, weights, calculations, etc.
- Incorrect cold-feed settings
- Non-uniform cold-feed delivery
- Stockpile segregation
- Stockpile contamination
- Storage bin segregation
- Intermingling of aggregates in stockpiles and/or feeders
- Wet, non-uniform stockpiles
- Degradation

When the sieve analysis test indicates the combined material does not comply with the gradation requirements, the plant inspector shall take the following steps:

1. Recheck test procedures and computations.
2. Check gate settings and feeder operations.
3. Check the materials and material handling procedures.
4. Notify the RCE, the DME and the contractor of the results.
5. Obtain a second sample and test promptly.

If the gradation tests and/or inspection observations indicate that proportioning irregularities are occurring, the contractor is required to take corrective action immediately. Adjustments in proportions and other job mix formula changes must be documented in writing, in accordance with [IM 511](#).

Several alternatives are normally available to the contractor when difficulties are encountered:

- Change material handling procedures.
- Correct proportioning.
- Change proportions. (Job Mix Formula irregularities change.)
- Waste fines collected by dust.
- Change materials. (New Job Mix Formula collection systems required.)
- Reset Job Mix Formula target.
- Change processing procedures at gradation source.

3. Asphalt Content Control (Also refer to [Materials IM 509](#).)

The control of this material component is the most important plant inspection responsibility because the performance of the finished pavement is directly related to the quantity of binder incorporated in the mix. Separate check systems are used for drum-mix and batch plants as follows:

a. Drum Mixing Type Plants

During the first day or two of operations, and during periods when asphalt or aggregate delivery is questionable, it is advisable to perform proportioning validation in addition to the measurements required in [IM 204](#). The specifications require drum-mixing plants to be equipped with totalizing asphalt meters and aggregate scales.

This equipment and information should be utilized for making continuous checks. Total asphalt delivered as indicated by the meter should be periodically compared with quantities used as determined by tank measurements.

Validation Methods:

- (1) Compare asphalt delivered by metering pump or scale with outage shown by 2 or 4 hour tank measurement (compare by pounds (kg), gallons (liters), or percent).
- (2) Compare total mix produced, including waste, to asphalt and aggregate delivered by plant for a given period of time.

b. Batch Type Plants

The operation of batch type plants should also be verified when work begins on a project. This is done by making intermediate tank measurements at 2-or 4-hour intervals and by checking the operation and sensitivity of the scale equipment.

If the measurements indicate that uniform control is not being maintained, the contractor is required by the specifications to adjust and correct his operations to obtain specification compliance. Such actions may include but not be limited to cleaning, repair, or replacement of equipment, recalibration of pumps and feeders, and training of personnel. In some cases it may be necessary for the contractor to obtain assistance from equipment manufacturers or distributors. Refer to the checklist on pages for possible causes of difficulty.

The inspectors should be aware of the fact that the specifications provide for establishing mutual agreements for determining asphalt quantities on projects involving small quantities, or intermittent or diversified operations.

c. Plant Inspection Control List

1. Before Calibration

- a. Check capacity of storage tanks.
- b. Check tank sticks.
 - i. Be sure they fit the tanks.
 - ii. Determine proper use. (touch stick or dipstick, percent of diameter or inches, etc.)
 - iii. Be sure tanks are level.
- c. Check piping and type of pumping system.
- d. Learn the contractor method of operating the system.
- e. Check the truck scales.

2. During Operation

- a. Determine percent binder by tank stick measurement method as required.
- b. Determine percent binder by verification as required.
- c. Check batch scales for sensitivity.
- d. Check truck scales for sensitivity and accuracy.

3. If Computed Percent Binder is High:

- a. Check tank stick readings and computations.
- b. Check to be sure that all mix produced was included in the computations.
- c. Check for spilled, wasted, or otherwise used asphalt cement.
- d. Check to be sure all asphalt listed as **added** during the period should be included.
- e. Check truck scales and total mix made.
- f. Check cold-feed and pump setting.
- g. Check aggregate delivery level for uniformity.

-
4. If Computed Percent Binder is Low:
 - a. Check tank stick readings and computations.
 - b. Check total mix made.
 - c. Check to be sure that all asphalt added during the period is included.
 - d. Check cold-feed and pump setting.
 - e. Check for plugged nozzle.
 - f. Check pumping pressures.
 - g. Check strainer screen.
 - h. Check truck scales.

IM 509 provides the detail procedure for making tank measurements and determining asphalt content.

G. Checking Scales

1. Batch Scales

Batch scale sensitivity shall be checked once per day during a normal working day by placing a weight equal to 1/10 percent of the batch weight but not greater than 20 lbs. on the fully loaded scales and observing the movement of the indicator. A properly sensitive scale will exhibit a visible indicator movement when so tested. If no indicator movement is visible, immediate corrective action must be taken by the contractor.

The specified scale delivery tolerance limits should be checked by periodically witnessing the batch weighing operations. Each scale indicator should consistently indicate the required weight within the specified delivery tolerance, and return to zero when unloaded within the specified 0.5 percent tolerance.

When automatic batch weighing equipment is used, the interlock system shall be set at the 1.0 percent limit as specified. They may be manually overridden to continue plant operation if the specified delivery tolerance is not exceeded. When the delivery tolerances are exceeded, the asphalt or aggregate batch sizes shall be adjusted manually to bring the batch into compliance, or it shall be wasted.

The plant superintendent or other authorized contractor representative must make all necessary scale and equipment settings and/or adjustments. Before the plant operation begins or resumes the plant inspector will independently determine for himself that the settings and/or adjustments are accurate and that the weights of material being delivered to the batch are correct.

Normal plant operation causes vibration, which tends to change these adjustments. Accumulation of material clinging to the inside of the weighing hopper can also cause these adjustments to drift. If the amount exceeds one percent of the material batch weight it must be removed and the empty weight readjusted to indicate a zero load.

2. Truck Scales

Truck scales shall be checked as provided in [Standard Specification 2001.07](#).

H. Specification Compliance

All materials shall be inspected prior to being incorporated in a pavement structure. Some materials are being shipped to projects under certification programs and others must have a report. In either case it is necessary to check and file the reports or certifications such that each final product component is properly identified and incorporated with the proper documentation. This is accomplished by obtaining the documents for each lot of material before incorporation. All shipments of all materials incorporated shall be logged as they are received.

A Non-compliance Notice (Form #225) shall be immediately delivered to the acting representative of the contractor for the area of construction involved whenever procedures or tests results on acceptance samples representing material to be incorporated or incorporated in the work indicate non-compliance with the specifications and plans. Appropriate action in accordance with the applicable specifications and Instructional Memorandums shall be taken.

I. Sampling and Testing

The Contractor's Laboratory Technician is responsible for meeting all sampling, testing, and documentation requirements as set forth by [Specification 2303](#) and [IM 511](#).

<p>NOTE: RAP gradation % passing is found on Form #955.</p>
--

J. Completed Project

When a project is completed, the plant inspector should again check all records and documentation for accuracy and completeness. It is also necessary to determine at this time the net quantity of materials incorporated in the project. The field records and plant records should be compared and final determinations made.

K. Diary and Report Requirements

1. The diary must be filled out daily.
2. Computer programs are provided to document what is required.

Daily Plant Report. This form is submitted daily to document plant operations, job control testing, and material placement on all hot mix and cold mix construction.

Identification of Sample for Test (Form #193). This form must accompany all samples submitted to the Central Laboratory and District Laboratories. Examples of completed forms have been included in this instruction.

3. Testing Worksheets. All worksheets and other original documents used by

inspection personnel are to include identification of: 1. individuals associated with sampling and testing, 2. County and Project No., 3. Material and sampling point, 4. Date and time of sampling and testing and, 5. Source, producer or contractor. All documents other than field notebooks are to be filed with the appropriate report and retained per the file retention schedule.

L. Mixture Segregation

In addition to determining if all of the required equipment is available, calibrated, and functioning properly, the plant inspector should monitor mixture uniformity for potential problems. One of the most troublesome difficulties encountered during production is mixture segregation, which may be caused by plant equipment or operation. Segregation at the plant may be caused by:

1. Pugmill discharge being too high above the truck bodies.
2. Depositing into very large truck bodies, causing the mixture to cone and roll. In this case trucks should be moved back and forth during loading.
3. Pugmill or storage gates opening improperly. They may not open or close quickly or to the full extent of the opening.
4. Inadequate mixing. This may be caused by short mixing cycle, improper mixer paddle positioning, worn paddles, or low level in the mixing chamber.
5. Improperly designed, maintained, and operated surge and storage bins and conveyors. Example - material discharge into conveyor must be centered into the bucket or belt.
6. Failure to provide near level truck charging platform.

Coarse, lean mixtures are more subject to segregation than fine-rich mixtures; therefore more care must be exercised when coarse mixtures are being produced. Segregation of the mix results in non-uniform distribution of the material in the pavement. This can lead to a patchy appearance as well as early structural distress.

M. Asphalt Binder Contamination

Another potential problem encountered during production is contamination of the asphalt binder. This may be caused by:

1. Allowing fuel oil used for cleaning pumps and lines to enter the storage tanks.
2. Accepting delivery of non-specification material or material of a different grade.
3. Leakage of plant heating oil into the storage tanks.

4. Contaminated delivery tanks.
5. Improper sampling, and sample catching container, refer to [IM 323](#).

Alert inspection and proper supervision can prevent contamination by the contractor since most of the problems are associated with the use of cleaning fluids and improper material combination.

Form 820193
7-94

Central
Lab. No. ABC4-000



Iowa Department of Transportation

IDENTIFICATION OF SAMPLE FOR TEST

(Read Instructions on back before taking sample and filling out form)

Material Uncompacted Mix @ 4.9% Binder Senders Sample No. 3DR4-001
 Intended Use HMA 30M S 3/4 L-2 Accounting ID Number 67-CO67-029
 County Monona Group No. _____ Design No. ABD4-001
 Project IM-29-5(89)106--13-67 Contract ID Number 12345
 Contractor Quality Construction Incognito, Iowa
(Name) (Address)
 Supplier Quality Binder Source Incognito, Iowa
 Producer Quality Binder Brand _____ Lot No. _____
 Location of Producing Plant _____
 _____ Sec. _____ Twp. _____ Range _____ Co. _____

Unit of Material Represented Approximately Station 105+00. Lift 2 of 2.
 Quantity Represented 40 lbs. Box

Sampled by Jon Rayson Incognito, Iowa
(name) (address)

Date sampled 06/01/04

Report to District(s) (Check appropriate box (es))
 1 2 3 4 5 6

Report to Residency (Write appropriate residency number) 22

Report to Counties (Write appropriate count number) 67

Report to Other Rayson Incognito, Iowa
(Name) (Address) (Phone)

Report to Other _____
(Name) (Title) (Address) (Phone)

Report to Other _____
(Name) (Title) (Address) (Phone)

Results need by: Date _____

Additional Detailed Information: (For paint give analysis printed on container. For tile give grade specified, etc.)

						" X " Sample Type	
Mix Info:						Assurance	
Lab Results:						Verification	
Intended %AC	Gmb	_____	1 1/2"	_____	#8		
Target Pa	Gmm	_____	1"	_____	#16	X	Project Information
# Gyration	Pa	_____	3/4"	_____	#30		Mix Design
# Blows			1/2"	_____	#50		Dept. Information
% RAP			3/8"	_____	#100		Warehouse Stock
% Add AC			#4	_____	#200		Research Project
Comments: _____							

Form 820193
7-94

Central
Lab. No. APG4-000



Iowa Department of Transportation

IDENTIFICATION OF SAMPLE FOR TEST

(Read Instructions on back before taking sample and filling out form)

Material PG 64 -28 Senders Sample No. 3CJP04-02PG
 Intended Use Verification Accounting ID Number 67-CO67-029
 County Monona Group No. _____ Design No. ABD4-001
 Project IM-29-5(89)106--13-67 Contract ID Number 12345
 Contractor Quality Construction Incognito, Iowa
(Name) (Address)
 Supplier Quality Binder Source Incognito, Iowa
 Producer Quality Binder Brand _____ Lot No. _____
 Location of Producing Plant _____

Sec. _____ Twp. _____ Range _____ Co. _____
 Unit of Material Represented 1 / 80 tons of binder
 Quantity Represented 1 Quart

Sampled by Jon Rayson Incognito
(name) (address)

Date sampled 06/01/04

Report to District(s) (Check appropriate box (es))
 1 2 3 4 5 6

Report to Residency (Write appropriate residency number) _____

Report to Counties (Write appropriate count number) 67

Report to Other Rayson Incognito, Iowa
(Name) (Address) (Phone)

Report to Other _____
(Name) (Title) (Address) (Phone)

Report to Other _____
(Name) (Title) (Address) (Phone)

Results need by: Date _____

Additional Detailed Information: (For paint give analysis printed on container. For tile give grade specified, etc.)

Please run complete testing

" X " Sample Type	
	Assurance
	Verification
X	Project Information
	Mix Design
	Dept. Information
	Warehouse Stock
	Research Project